

Quad Cities 2

4Q/2005 Plant Inspection Findings

Initiating Events

Significance:  Sep 30, 2005

Identified By: NRC

Item Type: NCV NonCited Violation

4160 VOLT RELAYING AND METERING SINGLE FAILURE VULNERABILITY

A finding of very low safety significance was identified when the licensee discovered that a spurious open circuit on the relaying and metering transformers for the unit auxiliary or the reserve auxiliary transformer could result in a loss of power to the residual heat removal service water system. This finding was determined to be a Non-Cited Violation of 10 CFR Part 50, Appendix B, Criterion III.

This finding was more than minor because if left uncorrected, the open circuit vulnerability would leave the station susceptible to a loss of the residual heat removal service water system following a loss of offsite power event. This finding was determined to be of very low safety significance because the frequency of the circuit failure was less than $1.0E-6$ and because the probability of experiencing a control room fire concurrent with the postulated circuit failure was also significantly low. Corrective actions for this issue included installing a temporary modification to eliminate the vulnerability, reviewing other electrical circuitry for similar vulnerabilities, and designing and installing a future permanent modification.

Inspection Report# : [2005005\(pdf\)](#)

Significance:  Jun 30, 2005

Identified By: NRC

Item Type: NCV NonCited Violation

FAILURE TO IMPLEMENT CORRECTIVE ACTIONS FOR THE TWO PREVIOUS BUS OVERLOAD EVENTS

A self-revealing finding of very low safety significance and a Non-Cited Violation of 10 CFR Part 50, Appendix B, Criterion XVI, were identified on March 27, 2005, due to the failure to implement effective corrective actions following the overloading of an electrical bus. This resulted in an overload of an electrical bus during the Unit 1 refueling outage and the loss the Unit 1 125 V battery chargers, the control room emergency ventilation system, and one half of the fuel pool cooling system.

This finding was more than minor because the ineffective corrective actions resulted in the procedures used to monitor loading on cross connected electrical buses being inadequate. This finding was of very low safety significance since the loads supplied by the Unit 1 battery chargers could be supplied from an alternate source, the fuel pool cooling loss did not result in a significant increase in temperatures, the Unit 1 reactor vessel water level was greater than 23 feet above the vessel flange, and the likelihood of a fire or toxic gas release occurring coincident with the loss of the electrical bus was very low. Corrective actions for this issue included reviewing all procedures which allowed buses to be cross connected to ensure that specific information regarding the prevention of bus overloading was included and establishing positive controls for cross connected equipment within the applicable procedures.

Inspection Report# : [2005003\(pdf\)](#)

Mitigating Systems

Significance:  Sep 30, 2005

Identified By: NRC

Item Type: NCV NonCited Violation

FAILURE TO FOLLOW THE CODE CASE N-513 CONTROL MEASURES FOR INSPECTIONS AND TESTS

A finding of very low safety significance was identified for the failure to adequately implement code case instructions for determining the operability and extent of condition when a pipe flaw was found on the residual heat removal service water system. The failure was determined to be a Violation of 10 CFR Part 50, Appendix B, Criterion III.

The finding was more than minor because, if left uncorrected, the extent of the piping flaw geometry would not be fully understood due to a lack of inspection that could result in inappropriately concluding that equipment important to safety was operable. The finding was considered to be of very low safety significance because the licensee was able to verify that the minimum pipe wall thickness of suspect examined areas of the residual heat removal service water piping welds met the functionality requirements for system operability. Corrective actions for this issue include the extent of condition ultrasonic tests that have been completed and the weld repair of the 1D residual heat removal service water pump flaw.

Inspection Report# : [2005005\(pdf\)](#)

G

Significance: Sep 30, 2005

Identified By: NRC

Item Type: NCV NonCited Violation

LACK OF PROCEDURE INSTRUCTION IN PROCEDURE QCEMS 0250-11 TO EVALUATE AERO SHELL 7 GREASE FOR LUBRICANT AND THICKENER SEPARATION

A finding of very low safety significance was identified for the failure to provide adequate instruction for the application of grease as a lubricant to 480 Volt motor control center auxiliary contacts during maintenance. The failure was determined to be a Violation of 10 CFR Part 50, Appendix B, Criterion V.

The finding was more than minor because, if left uncorrected, degraded grease could be applied during maintenance activities to impact the operability, availability, reliability or safety function of a mitigating system. The finding was considered to be of very low safety significance because the finding did not result in an actual loss of a safety system function. Corrective actions for this issue included the removal of the old Aero Shell 7 grease can from the electrical maintenance shop to prevent its use and the generation of work orders to clean and re-lubricate the CR105X auxiliary contacts where white residue has been identified at various motor control center cubicles during the January through February 2005 inspection.

Inspection Report# : [2005005\(pdf\)](#)

G

Significance: Sep 30, 2005

Identified By: NRC

Item Type: NCV NonCited Violation

MISAPPLICATION OF AERO SHELL 7 GREASE

A finding of very low safety significance was identified for failing to follow a maintenance procedure that resulted in the failure of residual heat removal valve 1-1001-26B to operate during testing. The failure was determined to be a violation of 10 CFR Part 50, Appendix B, Criterion V.

The finding was more than minor because if left uncorrected, this inappropriate maintenance practice would result in hardened grease in other auxiliary contact assemblies impacting the operability, availability, reliability, or safety function of mitigating systems. The finding was considered to be of very low safety significance because the finding did not result in an actual loss of a safety system function. Corrective actions for this issue include the auxiliary contact assemblies in the motor control center cubicle being replaced and properly lubricated with Dow Corning 44 grease.

Inspection Report# : [2005005\(pdf\)](#)

G

Significance: Jun 30, 2005

Identified By: NRC

Item Type: FIN Finding

FAILURE TO ADEQUATELY ADDRESS THE CONTINUED OPERABILITY OF SEVERAL BRASS FITTINGS AS PART OF OPERABILITY EVALUATION 328851

The inspectors identified a finding of very low safety significance in May 2005 while reviewing an evaluation used to justify the continued operability of commercial grade brass fittings installed on safety-related equipment. The primary cause of this finding was related to the cross-cutting area of Human Performance in that, engineering personnel had information regarding the fact that 5 out of 14 fitting batches were unable to be tested. However, information which justified the continued operability of the untested fittings was not included in the associated operability evaluation.

This finding was more than minor because if left uncorrected, the station could reach inappropriate conclusions regarding the continued operability of equipment important to safety. The finding was of very low safety significance because none of the safety-related equipment was determined to be inoperable. No violations of NRC requirements occurred since operability evaluations were not required by NRC regulations.

Inspection Report# : [2005003\(pdf\)](#)

G

Significance: Apr 08, 2005

Identified By: NRC

Item Type: FIN Finding

FAILURE TO INITIATE OPERABILITY DETERMINATIONS OR EVALUATIONS WHEN REQUIRED

The inspectors identified a finding of very low safety significance due to the licensee's failure to perform operability determinations/evaluations for non-safety related structures, systems, or components discussed in the Updated Final Safety Analysis Report which were discovered to be degraded.

This finding was more than minor because if left uncorrected, the failure to properly evaluate the continued operability of degraded equipment could result in the licensee inappropriately relying on structures, systems, or components that were unable to perform their safety function during an initiating event. The finding also impacted the cross-cutting area of problem identification and resolution because the licensee has

had multiple examples of failures to initiate operability determinations or evaluations which had not been previously identified. No violation of NRC requirements occurred since the completion of operability determinations/evaluations was not required by NRC regulations.

Inspection Report# : [2005002\(pdf\)](#)

Barrier Integrity

Emergency Preparedness

Occupational Radiation Safety

Public Radiation Safety

Physical Protection

[Physical Protection](#) information not publicly available.

Miscellaneous

Last modified : March 03, 2006